

Final Inspection Report

Comprehensive On-Site
Assessment

SEN BAO



SUMMARY

Final Inspection Report as on 28/01/2026
SILQ

BRAND SILQ	ORDER QTY 1344
INSPECTION LOCATION QINGYUAN - CHINA	EST. SHIPPING QTY 1344 (as per packing list)
TRADING AGENT / FACTORY SEN BAO	EX-FACTORY DATE 10/02/2026
PO NUMBER 04721	STYLE NO. & DESC. ELEANOR
PRODUCTION MATERIAL / CONSTRUCTION Exterior coating - 100% Polyurethane Exterior base fabric: 100% Recycled Polyester Lining: 100% Recycled Polyester	STYLE COLOR & CODE BLACK, HAZELNUT
INSPECTION IMAGES LINK NA	TOTAL CARTONS 112

TOTAL INSPECTED QTY (AS PER AQL LEVEL) INSPECTION RESULT

148 PCS
of 1344 PCS

PASS

ISSUE TYPE NO. OF ISSUES FOUND	STATUS & AQL LEVEL	ACCEPTED DEFECT LIMITS BY AQL
MAJOR DEFECTS 5	ACCEPTED	defects within upto 8 defects allowed AQL 2.5
MINOR DEFECTS 5	ACCEPTED	defects within upto 10 defects allowed AQL 2.5
CRITICAL DEFECTS Nil	ACCEPTED	defects within upto 0 defects allowed AQL 0.1



SILQ ID
Silq-4154531

REVIEW DATE REPORT DATE
28/01/2026 **28/01/2026**

SILQ INSPECTOR
WOLKER HUANG

SECONDARY REVIEW BY
Mr. Sundar
Senior Manager - Global Inspections

FACTORY REPRESENTATIVE / DESIGNATION
Mr Lin - QC

SILQ'S OBSERVATION	REMARKS
WORKMANSHIP (as per AQL Level)	OK
PRODUCT CONFORMITY	OK
MEASUREMENTS	OK
ONSITE TESTS	OK
PACKING	OK

NOTES & COMMENTS



- Approval sample received and returned to factory
- PO / Tech Pack / Measurement Chart recieved from Client
- Client to confirm release of goods

The Defects found by the Silq QC during inspection was shown to the factory
 - The Silq QC advised factory to Repair/Replace/ Reject these defects before dispatch of the goods

DISCLAIMER ** THE RESULT REFLECTS OUR FINDINGS FROM THE RANDOMLY DRAWN PIECES FROM THE TOTAL QUANTITY. THIS REPORT DOES NOT RELIEVE SELLER/MANUFACTURER/ EXPORTER / FACTORY FROM THEIR CONTRACTUAL LIABILITIES OR PREJUDICE BUYER'S RIGHT FOR COMPENSATION FOR ANY APPARENT AND/OR HIDDEN DEFECT NOT DETECTED DURING INSPECTION OR OCCURRING THEREAFTER. ANY UNAUTHORIZED ALTERATION, FORGERY OR FALSIFICATION OF THE CONTENT OR APPEARANCE OF THIS DOCUMENT IS UNLAWFUL AND OFFENDERS MAY BE PROSECUTED TO THE FULLEST EXTENT OF LAW.**

PRODUCT CONFORMITY (IN COMPARISON TO APPROVED SAMPLE AND TECH PACK INSTRUCTIONS)

DESCRIPTION	CONFORMITY	REMARKS
Style	CONFORM	
Product Quality / Weight	CONFORM	
Product Colour	CONFORM	
Product Construction Quality (body / making)	CONFORM	
Dyeing / Treatment / Wash / Handfeel	CONFORM	
Artwork / Application Size / Colour / Placement (print / emb / other embellishments)	CONFORM	
Labeling (main label / size label / washcare label / other labels)	CONFORM	
Fit	N/A	
Hangtag / Price tag / Barcode Stickers	CONFORM	
Product Odour	CONFORM	
Product Shades (body and artwork – piece-to-piece consistency in bulk)	CONFORM	
Accessories / Trims: Quality (snap buttons / velcro / zipper / buttons / zip puller / tapes / elastic/ wheels)	CONFORM	
Accessories / Trims: Functionality (snap buttons / velcro / zipper / buttons / zip puller / tapes / elastic/ wheels)	CONFORM	
Packing	CONFORM	
Others	CONFORM	

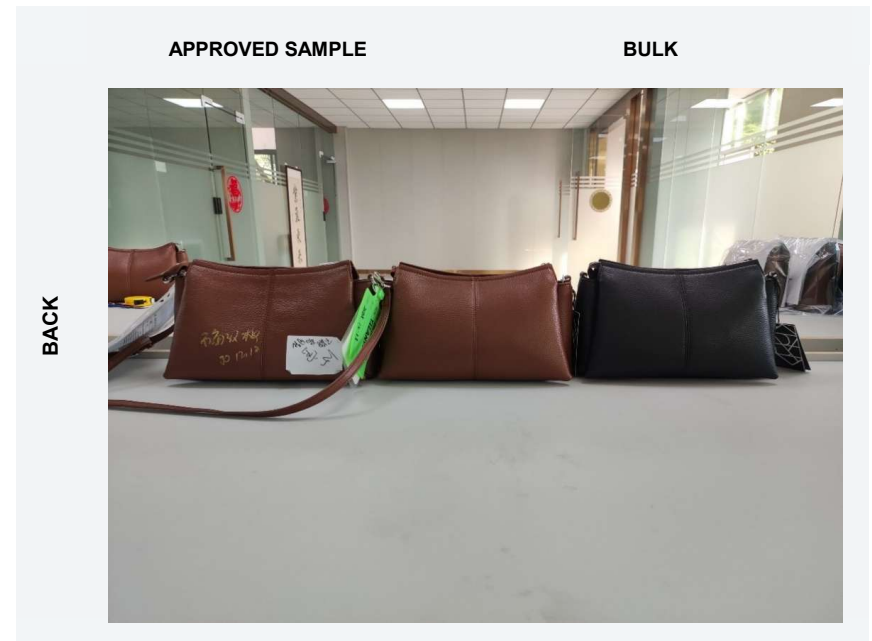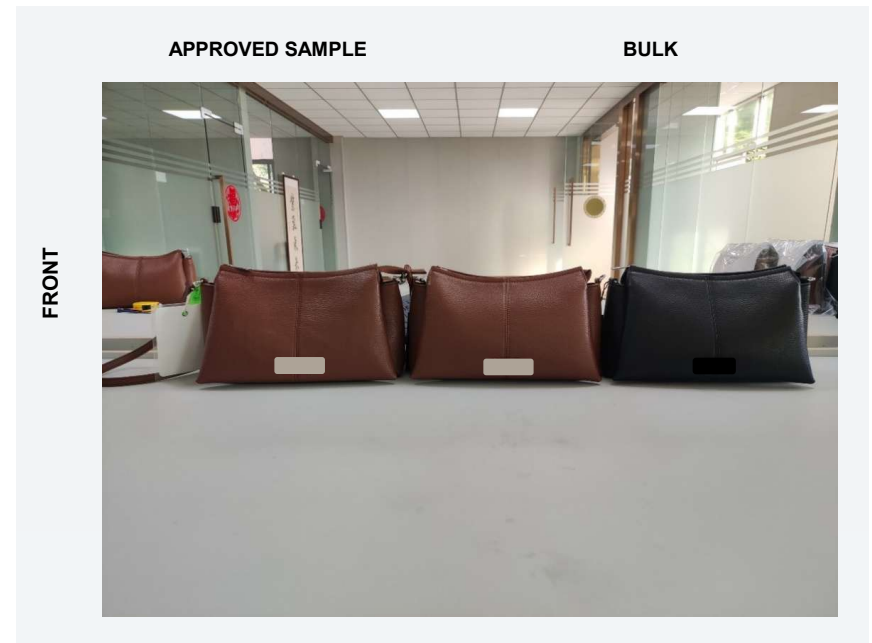

PRODUCT CONFORMITY IMAGES - ACCESSORIES AND TRIMS



LOGO



STYLE NAME



TSSA/COO LABEL



LOGO



STYLE NAME




TSSA/COO LABEL

PRODUCT CONFORMITY IMAGES



HANG TAG

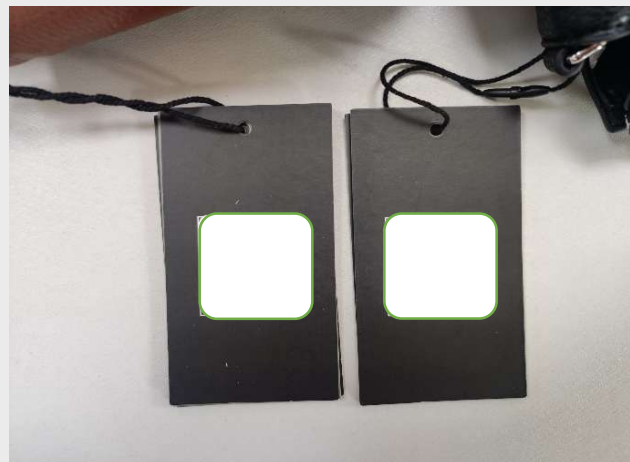

HANG TAG




D RING



STRAPS



HARDWARES

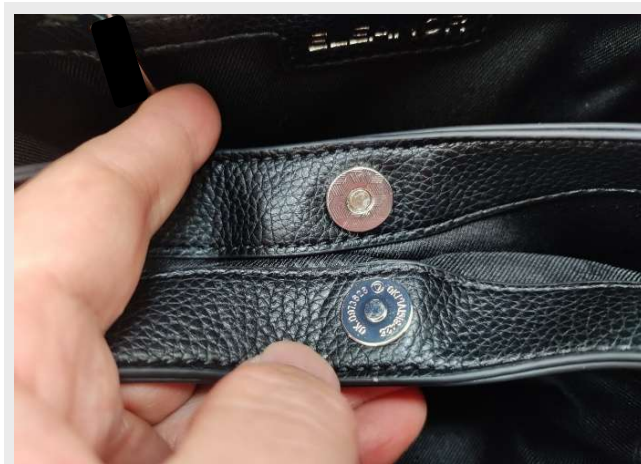

MAGNETIC BUTTON


ONSITE TESTS IMAGES



PULL TEST - SEAM SLIPPAGE



PULL TEST - ZIPPER

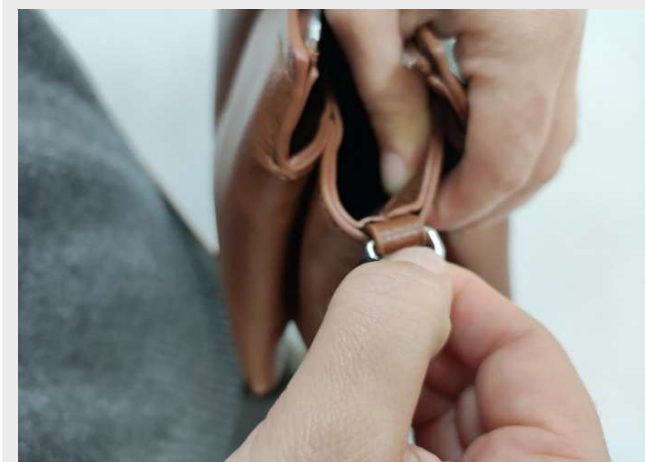

PULL TEST - D RING



PULL TEST - DOG CLIP



PULL TEST - LOGO



FUNCTION TEST - MAGNETIC BUTTON

DEFECT IMAGES



MAJOR
Crease marks



MAJOR
Cracked



MAJOR
Unmatched seam



MINOR
Wavy zipper



MINOR
Scratch

NA

PACKING AUDIT

DESCRIPTION	DETAILS	REMARKS
Order Quantity	1344	
Packed Quantity	1344	
Quantity Remarks - Shortage / Excess	0	
Quantity Shortage/Excess Approval from Client	N/A	
Total Cartons	112	
Carton Numbers	N/A	There is no carton number on the cartons
Final Packing Approval from Client	N/A	
Packing Status at the time of Inspection - Is it 100% packed?	NO	
If " Packing" status is NO, Cartons Packed / % Packed:	NO	Total 90 cartons around 80.36% of bulks were packed during inspection.
Carton Dimension (as per requirement)	OK	
Carton Marking - Length Side	OK	
Carton Marking - Width Side	OK	
Carton Quality	OK	
Polybag Quality	OK	
Polybag Size	OK	
Carton Weight within specified acceptable limits	YES	
Total Cartons Inspected	14	
Carton Sizes Used	OK	56 X 39 X23CM


PACKING PICTURES




CARTON MARKING



CARTON MARKING

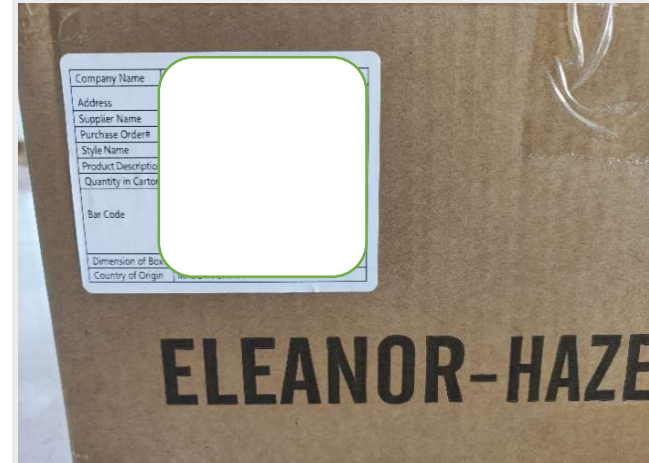

BARCODE LABEL

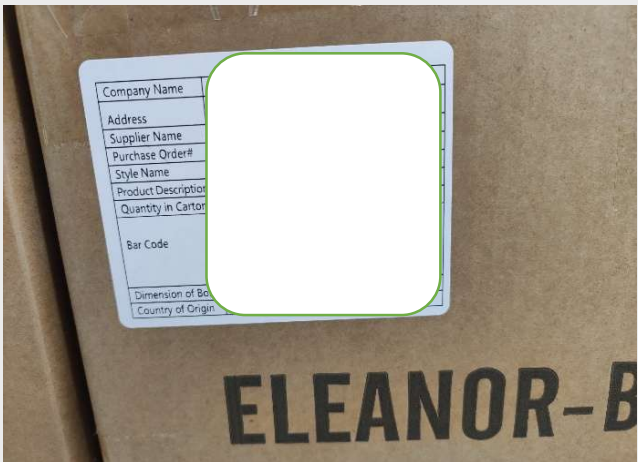

BARCODE LABEL



INSIDE CARTON



PACKING

PACKING IMAGES



UPC LABEL



POLYBAG



POLYBAG



ANTI-MILDEW SHEET



DUST BAG



CARE LABEL FOR THE DUST BAG