

Final Inspection Report

Comprehensive On-Site Assessment

SILQ FASHIONS, CHENNAI - INDIA



Powered by Silq Inspection Services For more information visit www.onesilq.com/inspections



FINAL INSPECTION REPORT

INSPECTED DATE	6/10/2023

	Section 1: GENERAL INFORM	MATION	
Client Name	ONESILQ	Inspection Type	Final Inspection
Brand	ONESILQ	Order Qty	1000 PCS
Inspection Location	ONESILQ	Est Shiiping Qty (as per packing list)	1000 PCS
Trading Agent/Factory	ONESILQ	Total Cartons	20 NOS
PO No.	PO- SILQ 01	Ex-Factory Date	6/20/2023
Style number & Description	MENS T-SHIRT SHORT SLEEVE	Link to Folder with	NIL
Style Color & Code	GREY	Inspection Images	INIL
Product Material / Construction	60% COTTON / 35% POLYESTER / 5%	INSPECTION RESULT	PASS

AQL : Agl level II	MA	JOR	MIN	IOR	CRIT	ICAL	INSPECTED QTY				
AQL . Aql level II	AQL	. 2.5	AQL	4.0	AQL	0.10	(AS PER AQL LEVEL)				
	Accepted	Rejected	Accepted	Rejected	Accepted	Rejected					
Allowed Limit	5	6	7	8	0	0					
							80 PCS				
Issues Found	4	1	5	5	(0	33 / 33				
RESULT	WITHIN A	QL LEVEL	WITHIN A	QL LEVEL	N	IIL					

SPANDEX- JERSEY - 200 GSM

SILQ OF	SERVATION	REMARKS
WORKMANSHIP (AS PER AQL LEVEL)	ОК	
PRODUCT CONFORMITY	ОК	
MESUREMENTS	HOLD	FOUND DEVIATION IN LENTH - REFER TO MEASUREMENT AUDIT PAGE - CLIENT TO CHECK AND CONFIRM
PACKING	ОК	


1. APPROVED SAMPLE PROVIDED BY FACTORY AND RETURNED TO FACTORY AFTER INSPCTION

2. PO SHEET / TECH PACK / MEASUREMENT CHART RECEIVED FROM CLIENT

3. APPROVED SAMPLE FOUND WITHOUT HANGTAG AND PRICE TAG

4. CLIENT TO CONFIRM FOR LENGTH MEASUREMENT DEVIATION

5. TO GET CLIENT CONFIRMATION FOR RELEASE OF GOODS

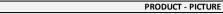

FRONT - VIEW



BACK - VIEW



INSPECTED BY								
Name	SUNDAR							
Designation	SENIOR MANAGER OPERATIONS							
Date	6/10/2023							

FACTORY	REPRESENTATIVE
Name	SURESH
Designation	MERCHANDISER
Date	6/10/2023

REVIEWED BY										
Name	SUNDAR									
Designation	SENIOR MANAGER OPERATIONS									
Date	2023-06-10									

** THIS REPORT DOES NOT RELIEVE SELLER/MANUFACTURER/ EXPORTER / FACTORY FROM THEIR CONTRACTUAL LIABILITIES OR PREJUDICE BUYER'S RIGHT FOR COMPENSATION FOR ANY APPERENT AND/OR HIDDEN DEFECT NOT DETECTED DURING INSPECTION OR OCCURING THEREAFTER.
UNAUTHORIZED ALTERATION, FORGERY OR FALSIFICATION OF THE CONTENT OR APPEARANCE OF THIS DOCUMENT IS UNLAWFUL AND OFFENDERS MAY BE PROSECUTED TO THE FULLEST EXTENT OF LAW.**

ANY



PRODUCT CONFORMITY CHECKS

			son to Approv	ed sample and Tech pack Instruction	
DESCRIPTION	CONFORMITY	REMARKS		Approved Sampl	e vs Production - Images
STYLE	CONFORM		FRONT	APPROVED SAMPLE	BULK
PROUCT QUALITY / WEIGHT	CONFORM				
PRODUCT COLOUR	CONFORM				
PRODUCT CONSTRUCTION QUALITY (BODY / STITCHING)	CONFORM			/ silq	Silq
DYING / TREATMENT / WASH / HANDFEEL	CONFORM			The same of the sa	
ARTWORK / APPLICATION SIZE / COLOUR / PLACEMENT (PRINT / EMB / OTHER EMBLISHMENTS)	CONFORM				
LABELING (MAIN LABEL/SIZE LABEL/WASHCARE LABEL/OTHER LABELS)	CONFORM				
FIT	CONFORM				The second secon
HANGTAG / PRICE TAG / BARCODE STICKERS	CONFORM		васк	APPROVED SAMPLE	BULK
PRODUCT ODOUR	CONFORM				
PRODUCT SHADES (BODY / ARTWORK - PCE TO PCE IN BULK)	CONFORM				
ACCESSORIES / TRIMS: QUALITY (SNAP BUTTONS / VELCRO / ZIPPER / BUTTONS / ZIP PULLER / TAPES / ELASTIC)	CONFORM			PART	
ACCESSORIES / TRIMS: FUNCTUANLITY (SNAP BUTTONS / VELCRO / ZIPPER / BUTTONS / ZIP PULLER / TAPES / ELASTIC)	CONFORM				
PACKING	CONFORM				
OTHERS	NA				To the Table

PRODUCT CONFORMITY - PICTURES

ACCESSORIES AND TRIMS

MAIN LABEL - PRINTED



SIZE LABEL - PRINTED



WASHCARE LABEL - PRINTED



SILQ LOGO - PRINT




POLYBAG FRONT



POLYBAG BACK





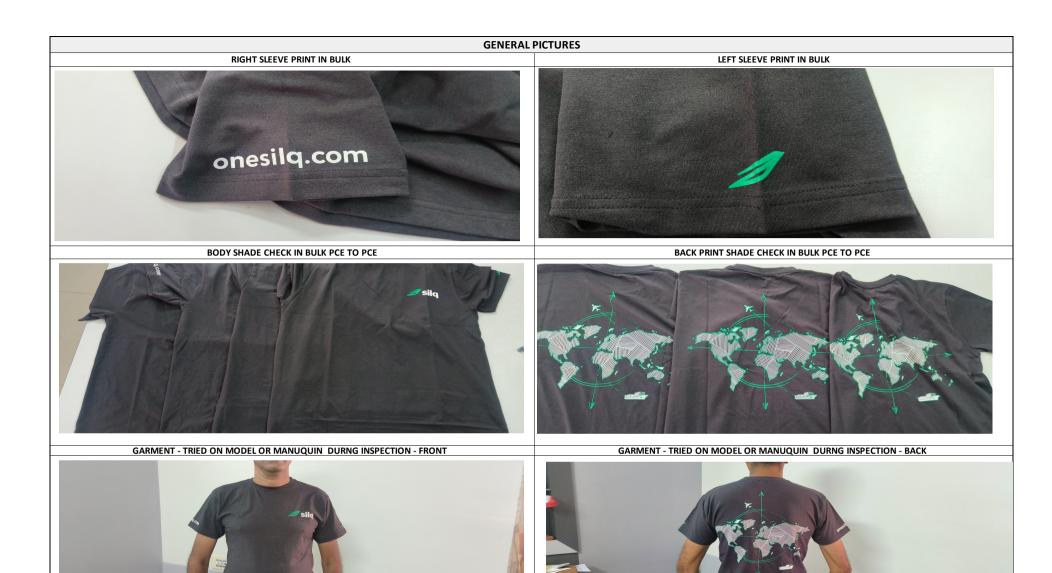



WORKMANSHIP AUDIT

INSPECTION DETAILS

NO. OF UNITS INSPECTED

80 PCS (AS PER AQL LEVEL - MAJOR = 2.5 / MINOR = 4)

Defect Classification	Defect Description		efective Uni		Remarks
Defect classification	Defect Description	Major Defect	Minor Defect	Critical	Nemarks
ArtworkDefects	neck print center out	1		0	
Sewing Defects	Uneven - neck shape	1		0	
FinishingDefects	untrimmed threads at side seam		1,1		
FinishingDefects	Handling Stains		1,1		
Artwork Defect	Back Print mistake	1,1			
FinishingDefects	stains		1		
	Total Defective Units - Found	4	5	0	
	Maximum Defects Allowed	5	7	0	





MEASUREMENT AUDIT

MEASUREMENT CHECKED 2 PCS IN EACH SIZE

													Size & N	leasuren	nents									
	Part Dimensions	Unit	Tol. Limit		Size	· S			Size	М			Size	e L			Size-	XL	Size-2XL					
		Inches	+/-	Spec	ı	II		Spec	ı	II		Spec	ı	II		Spec	ı	II	Spec	ı	II			
		•																						
Α	FRONT BODY LENGTH FROM HSP			28 1/2	ok	ok		29 1/2	ok	-1/2		30 1/2	-1/2	ok		32 1/2	ok	-1/2	33 1/2	ok	-3/4			<u> </u>
В	ACROSS SHOULDER			17 1/2	ok	ok		18 1/4	ok	ok		19	ok	ok		20 1/2	ok	ok	21 1/2	ok	ok			
c	NECK WIDTH (SEAM TO SEAM)			7 1/4	ok	ok		7 1/2	ok	ok		73/4	ok	ok		8	ok	ok	8 1/4	ok	ok			
D	FRONT NECK DROP HSP TO NECK SEAM			4	-1/4	ok		4	ok	+1/8		4 1/2	ok	-1/4		5	-1/4	-1/4	5 1/4	-1/4	+1/4			
E	BACK NECK DROP HSP TO NECK SEAM			3/4	ok	ok		3/4	ok	ok		3/4	ok	ok		3/4	ok	-1/8	3/4	-1/8	ok			
F	ACROSS FRONT MID OF ARMHOLE			16	ok	ok		16 3/4	ok	ok		17 1/2	ok	ok		19	ok	ok	20	ok	ok			
G	ACROSS BACK MID OF ARMHOLE			16 1/4	-1/4	ok		17	-1/4	ok		17 3/4	-1/4	-1/4		19 1/4	-1/4	-1/4	20 1/4	ok	-1/4			
н	1/2 CHEST			19 1/4	-1/2	-1/4		20 1/4	ok	ok		22	-1/2	-1/2		24 1/2	ok	ok	28 1/2	-1/2	-1/2			
1	1/2 WAIST			19	ok	ok		20	ok	ok		21 3/4	-1/2	ok		24 1/4	'-1/4	ok	28 1/4	ok	ok			
J	1/2 BOTTOM HEM STRAIGHT			19	-1/2	-1/2		20	-1/2	-1/2		21 3/4	-1/2	-1/2		24 1/4	-1/2	-1/2	28 1/4	-1/2	-3/4			
К	ARMHOLE STRAIGHT			9	+1/2	ok		9 5/8	ok	+1/4		10 1/4	ok	+1/4		10 3/4	+1/4	+1/4	11 1/4	ok	+1/4			
L	SLEEVE LENGTH			7 3/4	+1/2	ok		8	ok	ok		8 1/4	+1/4	ok		8 1/2	+1/4	+1/2	8 5/8	+1/4	-3/8			
М	SLEEVE OPENING			6 1/4	ok	ok		6 1/2	ok	ok		63/4	ok	ok		7	ok	ok	7	ok	ok			
N	SLEEVE HEM HEIGHT			3/4	-1/4	ok		3/4	ok	ok		3/4	ok	-1/4		3/4	-1/4	-1/4	3/4	ok	ok'			
0	NECK RIB HEIGHT			3/4	-1/4	-1/4		3/4	-1/2	-1/4		3/4	1/4	-1/2		3/4	-1/4	-1/2	3/4	-1/4	-1/2			
Pieces	Found Out of Tolerance					1	'		1	1	L.						L.	1		U				-

1. Front length found deviation - but on overall fit looks OK - Client to confirm

MEASUREMENT RE-AUDIT (IF NEEDED)

	Unit Tol.		Tol.		Size & Measurements																				
	Part Dimensions	Unit	Limit		Size-1																Size-2				
Inche			+/-	Spec	- 1		II	III	IV		٧	VI	VII		VIII	VI	Х		Spec	VI	-	=	VIII	IX	Х
Pieces I	Pieces Found Out of Tolerance																								

		1						1	
ORDER QTY		1000 PCS			CARTON DIMENSION (as per requirement)			ОК	
SKEEK QTT		10001 C5			(as per require	inent j		OK	
PACKED QTY		1000 PCS QTY PRODUCED AND PACKED			CARTON MARKING - LENGTH SIDE			OK	
QTY REMARKS - SHORTAGE / EXCESS		NIL			CARTON MARK	CARTON MARKING - WIDTH SIDE			
QTY APPROVAL FROM CLIENT FOR SHORT /									
EXCESS		NA		CARTON QUALITY			OK		
TOTAL CARTONS		20 NOS			POLYBAG QUAL	POLYBAG QUALITY			
CARTON NUMBERS		1- 20			POLYBAG SIZE	POLYBAG SIZE			POLYBAG SIZE FOUND = 10"X12" -
HAS FACTORY GOT FINAL PACKING APPROVAL FROM CLIENT		Yes			IS CARTON WIEGHT - WITHIN ACCEPTABEL LIMIT AS PER CLIENT REQUIREMENT			CARTON WEIGHT FOUND - 12 KGS	
Did 100% of the production lot completely packed?		Yes			TOTAL CARTON	TOTAL CARTONS INSPECTED			
If goods not packed 100% - how many cartons packed during inspection and								F6 V 26 V 26 61	46
percentage of packed goods					CARTON SIZES USED			56 X 36 X 26 CMS	
PO Number / Colour			MASTE	R CARTON NU	JMBERS INSPECT	ED BY SILQ			
To Humber / colour	S	M L		XL	2XL		TOTAL CAP	RTONS INSPECTED	
GREY	1,3	10,13	15,16	17,18	19,20	52,55	10		_

TOTAL

10

