


# SAMPLE INSPECTION REPORT

Sample Quality Assessment

ROYAL SYNTHETICS INDIA PVT LTD, LUDHIANA, INDIA

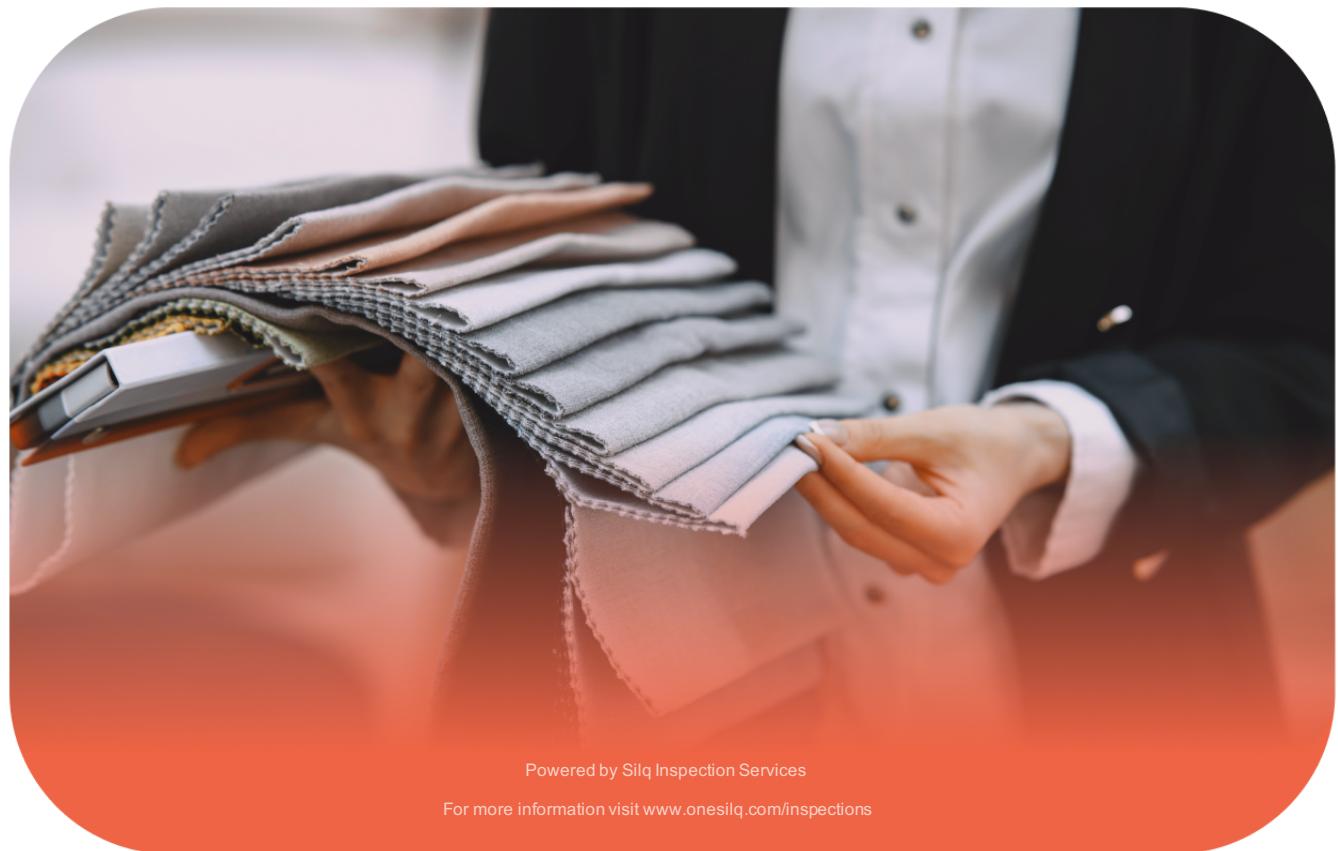

Powered by Silq Inspection Services

For more information visit [www.onesilq.com/inspections](http://www.onesilq.com/inspections)

# Sample Inspection Report



## Sample Quality Assessment

Sample Overview		
Sample received on time	YES	
Correct quantity of samples	YES	
Correct size(s) submitted	YES	Size - M - 2 pcs
Matching buyer's tech pack/spec	YES	
Final approval sample clearly labeled	YES	
Material and Fabric Check		
Fabric type matches PO/tech pack	YES	
GSM/Weight as specified	YES	
Color shade matches standard	NO	Slight variation compared to approved labdip
All labels are attached in sample	YES	
Hangtags attached to sample	YES	
Construction & Measurements		
Fabric Quality	YES	
Print/embroidery quality	YES	
Print/embroidery Colour	YES	
Stitch type as per requirement	YES	
Stitch quality	YES	
Seams strength and alignment	YES	
Trims, Accessories & Labelling		
Buttons/zippers/Trims match specification	YES	
Hangtags, size labels, care labels	YES	
Placement of labels	YES	
Trims securely attached	YES	
Functionality & Fit Check		
Ease of wear/removal	YES	
Fit on mannequin or model	YES	
Functionality of closures	YES	
Overall aesthetic appeal	YES	
Packing Quality & Presentation		
Folding as per buyer requirement	YES	
Packed in actual Polybag	YES	
Polybag sticker	YES	
Hangtag sticker	YES	
		
General Information		
INSPECTION DATE	05/14/2025	
FACTORY NAME & ADDRESS	Silq Fashion - India	
BUYER/BRAND	Silq	
PURCHASE ORDER NO.	Silq 30124	
STYLE NO. / ARTICLE NO.	Silq 5125	
ITEM DESCRIPTION	LADIES PANT WITH WRAPPING	
SUBMISSION DATE	05/14/2025	
SAMPLE TYPE	Pre-Production	
SAMPLE RESULT	HOLD	

# Sample Inspection Report



Sample Quality Assessment

## MEASUREMENT CHECK

Point of Measurements	Unit Inch	Tol. Limit + / -	Size-S/M			Size-L/XL	
			Required Measurement	Required Measurement	Required Measurement	Required Measurement	Required Measurement
1/2 Wasit	1	<b>12 5/8</b>	3/8	1/8	<b>15 5/8</b>	3/8	3/8
1/2 Hip	1	<b>19 1/4</b>	3/8	1/2	<b>22 1/4</b>	3/4	3/8
1/2 Thigh	1/2	<b>13 1/8</b>	3/8	3/8	<b>14 5/8</b>	1/8	1/2
1/2 Hem	1/2	<b>12</b>	0	0	<b>13 1/2</b>	0	0
Inseam length	0	<b>35 1/2</b>	1/8	0	<b>35 1/2</b>	1/8	1/8
Front rise	1/4~1/8	<b>14</b>	1/8	1/8	<b>14 3/8</b>	0	1/8
Back rise	<b>1/4</b>	<b>16</b>	<b>1</b>	<b>1</b>	<b>16 3/4</b>	<b>1</b>	<b>1</b>
Tie length	0	<b>54</b>	0	0	<b>54</b>	0	0
Side zipper pocket length	1/4	<b>5 1/2</b>	1/8	0	<b>6</b>	-1/8	0
Zipper length	0	<b>6 1/2</b>	1/4	1/4	<b>6 1/2</b>	1/4	1/4
CF waistband depth	0	<b>4</b>	1/8	0	<b>4</b>	-1/8	0
CB waistband depth	0	<b>2 1/2</b>	1/8	0	<b>2 1/2</b>	1/8	0
Front waistband width@top	1	<b>13</b>	0	1/8	<b>16</b>	1/8	1/8
Front overlap hem width	1/4	<b>5 1/2</b>	0	0	<b>6 1/4</b>	0	0

## INSPECTOR COMMENTS & RECOMMENDATIONS

1. Colour is Slightly varying from the approved Labdip - Client to confirm
2. Remove Stains before ironing
3. Trim the threads properly before sending
4. Iron neatly & Pack it suitable polybag
5. Client to confirm on the above Measurement deviation

## INSPECTION SUMMARY

Sample Approved for Dispatch HOLD Client to confirm on the Colour & Measurement Variation before Dispatch

Re-submission Required NA

Suggested Corrections YES Corrections needed on the above said comments

## FOR INTERNAL USE ONLY BY SILQ

Silq ID Silq-9820987

Report Date 05/07/25

Silq Inspector Sundar

Secondary Review By Silq Manager Sundar - Senior Manager Global Inspections

# Sample Inspection Report

Sample Quality Assessment




## ACCESSORIES AND TRIMS



MAIN LABEL



SIZE LABEL

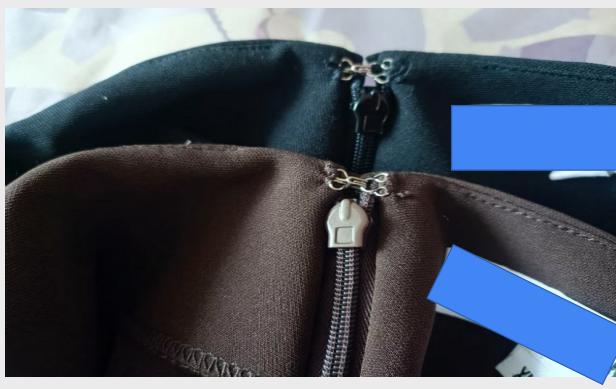

ZIP



HOOK



EYELET



SELF FABRIC DRAWCORD

# Sample Inspection Report

Sample Quality Assessment



SAMPLE IMAGES COLLECTED BY SILQ



GARMENT FRONT



GARMENT BACK



GARMENT RIGHT SIDE



GARMENT LEFT SIDE



GARMENT FRONT



GARMENT BACK